
Detailed Analysis Results in the Port of Fukushima Daiichi NPS, around Discharge Channel and Bank Protection (Sampling Locations of Seawater)

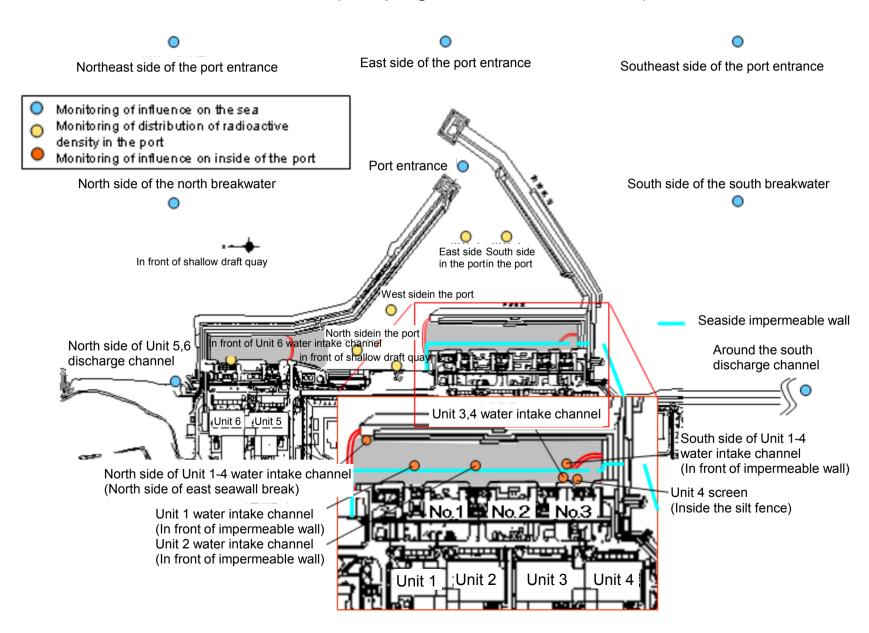

Detailed Analysis Results in the Port of Fukushima Daiichi NPS, around Discharge Channel and Bank Protection Seawater

Unit: Bq/L

	1F, North side of Unit 5,6 discharge channel	1F, In front of Unit 6 water intake channel	1F, In front of shallow draft quay	1F, North side of Unit 1-4 water intake channel (north side of East Seawall Break)	1F, In front of Unit 1 discharge channel (in front of impermeable wall)	channel (in front	1F, Between the water intake channel of Unit 3 and Unit 4	1F, Unit 4 Screen (Inside the Silt Fence)	1F, South side of Unit 1-4 water intake channel (In front of impermeable wall)	south discharge	Specified	drinking-
Date of Sampling			/	Jul 14, 2014	Jul 14, 2014	Jul 14, 2014			Jul 14, 2014	/		
Time of sampling				4:00 PM	3:45 PM	3:35 PM			3:20 PM	/		
Cs-134(Approx. 2 years)				7.6	9.1	7.2			9.3		60	10
Cs-137(Approx.30 years)				27	27	22			29		90	10
Gross β				150	140	130			190			
H-3 (Approx. 12 years)			/	300	260 ^{*1}	280			510		60,000	10,000
Sr-90 (Approx. 29 years)	/	/	V	-	-	-		/	-	V	30	10

Unit: Bq/L

	1F, Port entrance	1F, East side in the port	1F, West side in the port	1F, North side in the port	1F, South side in the port	North side of the north breakwater	Northeast side of the port entrance	East side of the port entrance	Southeast side of the port entrance	South side of the south breakwater	Density Limit Specified by the Reactor Regulation	WHO Guidelines for drinking- water quality
Date of Sampling												
Time of sampling												
Cs-134(Approx. 2 years)											60	10
Cs-137(Approx.30 years)											90	10
Gross β												
H-3 (Approx. 12 years)								/			60,000	10,000
Sr-90 (Approx. 29 years)	/		/		/			/			30	10

^{*1} The highest measurement value (compared to the previous values provided in the handouts published in 'Detailed Analysis Results in the Port of Fukushima Daiichi NPS, around Discharge Channel and Bank Protection')

^{* &}quot;ND" indicates that the measurement result is below the detection limit, and the detection limit of each nuclide is provided in parentheses.

^{* &}quot;-" indicates that the measurement was out of range.

^{*} Density Limit Specified by the Rule for the Installation, Operation, etc. of Commercial Nuclear Power Reactors (the density limit in the water outside the surrounding monitored areas is provided in section 6 of Appendix 2 [the amount is converted from Bq/cm³ to Bq/L]).

<Reference> The Highest Dose Until the Previous Measurement* (Seawater)

Unit: Bq/L

		side of Unit arge channel		nt of Unit 6 ake channel		t of shallow quay	4 water in (north s	side of Unit 1- take channel ide of East all Break)	discharge front of in	ont of Unit 1 e channel (in npermeable wall)	intake cha and Uni	een the water nnel of Unit 1 t 2 (surface ayer)	intake char	en the water nnel of Unit 1 (lower layer)	discharge front of in	ent of Unit 2 e channel (in enpermeable vall)	intake char	en the water nnel of Unit 2 Unit 3	intake chan			4 Screen Silt Fence)	4 water int (In front of	side of Unit 1- cake channel impermeable vall)
Cs-134(Approx. 2 years)	1.8	[6/21]	2.8	[12/2]	5.3	[8/5]	32	[10/11]	12	<6/23>	87	[10/10]	93	[10/10]	7.9	<6/23>	52	[12/21]	37	<5/12>	62	[9/16]	15	<4/14> <5/19>
Cs-137(Approx.30 years)	4.5	<3/17>	5.8	[12/2]	8.6	[8/5]	73	[10/11]	33	<5/12>	200	[10/10]	200	[10/10]	27	<6/23>	110	[10/11] [12/21]	98	<5/12>	140	[9/16]	45	<5/19>
Gross β	17	<1/6>	46	[8/19]	40	[7/3]	320	[8/12]	140	<5/5>	1,900	<5/20>	1,500	<6/10>	140	<6/23>	1,000	<6/2>	660	<6/9>	610	<6/23>	380	<3/10>
H-3 (Approx. 12 years)	8.7	<5/12>	24	[8/19]	340	[6/26]	510	[9/2]	230	<6/23>	4,200	<5/27>	3,900	<6/10>	300	<6/23>	2,600	<6/2>	2,500	<6/23>	2,100	<6/23>	720	<6/16>
Sr-90 (Approx. 29 years)	4.7	[6/26]	-		7.2	[6/26]	220	[8/19]	-		480	[8/22]	290	[10/20]	-		340	[10/14]	190	[9/23]	140	[6/21]	-	

Unit: Bq/L

		d the south e channel	1F, Por	t entrance	1F, East si	de in the port	1F, West si	ide in the port		side in the port		n side in the port		of the north kwater		side of the ntrance		East side of the south breakwater										side of the eakwater	South side of the south breakwater	
Cs-134(Approx. 2 years)	1.8	<6/9>	3.3	[12/24]	3.3	[10/17]	4.4	[12/24]	5.0	[12/2]	3.5	[10/17]	ND		ND		ND		ND		ND									
Cs-137(Approx.30 years)	4.9	<6/9>	7.3	[10/11]	9.0	[10/17]	10	[12/24]	8.4	[12/2]	7.8	[10/17]	ND		ND		1.6	[10/18]	ND		ND									
Gross β	16	<6/9>	69	[8/19]	74	[8/19]	60	[7/4]	69	[8/19]	79	[8/19]	ND		ND		ND		ND		ND									
H-3 (Approx. 12 years)	5.6	<5/19>	68	[8/19]	67	[8/19]	59	[8/19]	52	[8/19]	60	[8/19]	4.7	[8/14]	1.7	<4/23>	6.4	[10/8]	1.8	<5/29>	2.8	<4/23>								
Sr-90 (Approx. 29 years)	0.29	[6/26]	49	[8/19]	_		_		-		1		1		1		-		-		-									

^{*} The highest result announced in "Detailed Analysis Results in the Port of Fukushima Daiichi NPS, around Discharge Channel and Bank Protection" or the other handouts is provided.

As for "1F, North side of Unit 1-4 water intake channel", the data is obtained since January 14, 2013. For the other locations, the data is obtained since June 14.

[Reference] Standard values

Unit: Bq/L

	Cs-134	Cs-137	H-3	Sr-90
Density Limit Specified by the Rule for the Installation, Operation, etc. of Commercial Nuclear Power Reactors (the density limit in the water outside the surrounding monitored areas is provided in section 6 of Appendix 2)	60	90	60,000	30
WHO Guidelines for drinking-water quality	10	10	10,000	10

[•] Since some samples are still under analysis, the highest dose of the Strontium-90 is among those previously announced.

^{* &}quot;ND" indicates that the measurement result is below the detection limit.

^{*} Date of sampling is provided in parentheses. (): 2013, < >: 2014

^{* &}quot;-" indicates that the measurement was out of range.